

TECHNICAL & SAFETY COMMITTEE

INTERNATIONAL PARACHUTING COMMISSION (FAI)




Technical & Safety Information Notice No.	03/2009 W.N. 24 Note – this Information Notice supersedes IN 01/2009, W.N. 22, issued 28 January 2009. Please replace IN 01/2009 with this IN.
Date of Issue	05 May 2009
Subject Matter and Applicability	APF SERVICE BULLETIN No. APF010801-C* Issued 02 March 2009 SUBJECT: 3-RING INSPECTION AND MAINTENANCE STATUS: Part A – Inspection- MANDATORY Part B – Maintenance- RECOMMENDED IDENTIFICATION: All 3-ring release systems. BACKGROUND: In order that 3-ring risers achieve the optimum strength and ease of release under load they should conform to certain criteria. Following serious incidents in the past the APF originally issued this Service Bulletin in August 2001. After a riser failure in Jan 2009 this bulletin was re-issued with a requirement that the riser inspection was carried out and noted on the reserve packing card and marked on the risers to ensure that all 3-ring assemblies were critically inspected. This inspection and discussions with some manufacturers highlighted that there are now various styles of 3-ring releases being manufactured that do not adhere to the August 1998 3-Ring Release Construction Manual published by the Relative Workshop (now United Parachute Technologies). Manufacturers produce 3-ring risers in various configurations using differing components such as oval middle rings, reverse risers or loops that do not pass through a grommet inserted in the riser as well as heavy duty rings on tandem equipment. The manufacturer's manual for their particular harness / riser assembly should be referred to for the correct inspection, maintenance and assembly of the 3-ring. The basic criteria for assessing correctly built 3-ring risers are listed here under Part A – Inspection.

Part A - INSPECTION:

While 3-ring risers may be constructed of various webbing widths and differing components, mixing of mini- risers on large harness rings may also create problems. Care should be taken that the risers are compatible with the harness and that the following criteria is complied with.

- . Under moderate tension the rings should overlap each other and maintain metal to metal contact between each other.
- . The rings should be aligned in parallel planes.
- . The smallest ring should NOT be pulled snug against the grommet / riser by the locking loop which should be long enough to give it some play.
- . The locking loop should go straight through the riser grommet on its way to the cable housing end fitting (may vary on reverse risers or no grommet through riser type)
- . It should be checked that NO suspended load is supported by the cable housing and locking loop due to the cable housing being incorrectly positioned in the harness or being too short.

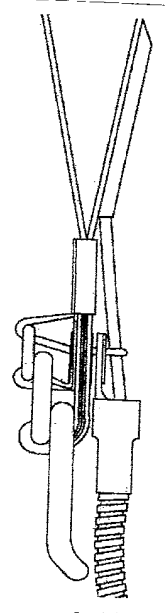

Part B – MAINTENANCE

Disassembly

Each month the 3-ring release should be operated on the ground by pulling the cables out.

While it is disassembled closely inspect the system, vigorously flex the webbing near each ring to remove any 'set', rotate the rings and check for bends and elongation and check around the riser grommet for webbing failure.

Check the white locking loop for any wear.

Check the inside of the Bendix release cable housing for gravel or other obstructions and feel for any dents where the housing runs through the rig. Check the hand tacking which secures the housing to the rig.

Clean and lubricate the cables with a light oil such as '3-in-1'. Put some drops on a cloth and firmly wipe the cables a few times, a THIN, invisible film should remain – too much will attract dirt and grit.

Reassembly

Do not reverse the risers. Line check if necessary.

Ensure each ring passes through **only** one other ring...

...and that the locking loop passes through **only** the small ring.

Do not kink the cables or twist the locking loop during assembly.

APF POLICY:

Owners are responsible for the daily airworthiness of their equipment. They should familiarise themselves with the correct geometry and maintenance of the 3-ring release as specified in the harness / container owner manual as supplied by the manufacturer. (The manual may in most instances be downloaded from the manufacturer's web site).

Inspection:

3-rings which do not conform to the inspection criteria above or the manufacturer's manual shall be grounded until inspected by an APF rigger or manufacturer to determine if the risers are:

- Acceptable / compatible,
- Will be acceptable following modification or repair,
- Cannot be modified or repaired and removed from service / replaced.

Compatibility, inspection and maintenance of 3-ring risers must be determined in accordance with the manufacturer's manual or directives issued as a service bulletin.

Maintenance:

**Carefully inspect the 3-ring prior to each jump.
Conduct the maintenance and reassembly of the 3-ring each month following the recommended procedures.
Immediate inspection should be carried out if the rig has been subjected to some abuse such as being dragged, a water landing or exposure to a lot of dust or sand.**

AUTHORITY: APF Director Rigging

EFFECTIVE DATE: 2nd February 2009

DISTRIBUTION: To all APF Packers and Riggers
To all APF members via the APF web site

**This Service Bulletin replaces APF SB 010801-B Issued January 2009*

PARACHUTES AUSTRALIA SERVICE BULLETIN No. PA SB0901 covers the same issue as the APF Bulletin and states that all 3-ring risers manufactured by Parachutes Australia may remain in service provided they meet the requirements as laid down in the APF SB No. APF010801-C*

PA manufactured 3- ring risers not meeting the requirements of APF Service Bulletin APF010801-C must be sent to PA for correction and return at no charge.

The owners of PA manufactured 3- ring risers that have locking loops shorter than that as detailed in the above mentioned Safety Notice but do meet the requirements of APF Service Bulletin APF010801-C that feel uncomfortable about the length of the locking loops can also send them to PA for lengthening and be returned at no charge.

	Owners of 3-ring risers not manufactured by PA which do not conform to APF Service Bulletin APF010801-C can send these to PA however will attract a charge.
Compliance	The Australian Parachute Federation has designated the status of its Service Bulletin as – Part A, Inspection – Mandatory Part B, Maintenance – Recommended Parachutes Australia has designated the status of its Service Bulletin as - Immediate Compliance
Concerned Publication	APF SERVICE BULLETIN No. APF010801-C* PARACHUTES AUSTRALIA SERVICE BULLETIN No. PA SB0901
Authority	APF Director Rigging in the case of the APF Service Bulletin Managing Director, Underline Designs Pty Ltd, trading as Parachutes Australia
Acknowledgement	Thanks to Kim Hardwick, Technical Officer, APF, for bringing these notices to the attention of the T&S Committee. Liam McNulty IPC Technical & Safety Committee 05 May 2009

Technical and Safety Information Notices issued by the Technical & Safety Committee of the International Parachuting Commission (FAI) are issued as information and help to parachuting nations and their affiliated members. The Information Notices are of an objective informative nature and there is no direct or implied criticism of any manufacturer or product intended. The Information Notices do not claim to be complete.

The Information Notices may result from:-

- 1 An incident or experience in the field being reported.*
- 2 A directive or notice issued by an aviation or government authority concerning parachuting operations or parachuting equipment.*
- 3 The issue of a notice by a manufacturer or by a National Parachuting Organisation. In the case of equipment being the subject of the bulletin the reader is advised to check with the manufacturer regarding the current status or position of that equipment.*

Technical & Safety Committee of IPC, IPC and FAI accept no liability for the use or misuse of any information contained in this Information Notice. The reader assumes all liability.

The Technical & Safety Committee, International Parachuting Commission, can be contacted on e-mail - lmcnulty@skydiveireland.ie

*Liam McNulty, Technical & Safety Committee, International Parachuting Commission.
05 May 2009*