TECHNICAL & SAFETY COMMITTEE



INTERNATIONAL PARACHUTING COMMISSION (FAI)

Technical & Safety Information Notice No.	4/2013 SUPPLIER/VENDOR RECALL OF PS70104 HOUSINGS (METAL FLEX HOSING INC)						
	ALLJA101XX HARNESS CONTAINER ASSEMBLIES (JAVELIN						
	ODYSSEY) WITH METAL FLEX HOUSING BATCH # 33234A AND 33227, 375ID PS70104 HOUSINGS. W.N. 46						
Date of Issue	23 May 2013						
Subject Matter and							
Applicability	SUN PATH SERVICE BULLETIN SPSB009						
	DATE: May 23, 2013						
	SERVICE BULLETIN # SPSB009						
	SUBJECT: SUPPLIER/VENDOR RECALL OF PS70104 HOUSINGS (METAL FLEX HOSING INC)						
	STATUS: MANDATORY INSPECTION AND REPLACEMENT OF RECALLED HOUSINGS.						
	IDENTIFICATION: ALL JA101XX HARNESS CONTAINER						
	ASSEMBLIES (JAVELIN ODYSSEY) WITH METAL FLEX HOUSING BATCH # 33234 A AND 33227, .375ID PS70104 HOUSINGS. SEE SERIAL NUMBER LIST BELOW.						
	38159 38899 38945 38979 39013 39037 39058						
	38231 38900 38946 38980 39014 39038 39060						
	38453 38901 38947 38982 39021 39039 39061						
	<u>38523</u> <u>38902</u> <u>38953</u> <u>38984</u> <u>39022</u> <u>39040</u> <u>39063</u>						
	38589 38903 38959 38985 39023 39041 39064 38753 38904 38960 38986 39024 39042 39066						
	38735 38904 38960 38966 39024 39042 39066 38799 38905 38961 38987 39025 39043 39070						
	38800 38906 38963 38988 39026 39044 39076						
	38860 38907 38964 38989 39027 39045 39083						
	38890 38908 38967 38990 39028 39046 39087						
	38891 38909 38968 38991 39029 39047 39089						

38892	38910	38970	38992	39030	39048	39118
38893	38912	38971	38993	39031	39049	39165
38894	38913	38972	38994	39032	39050	39419
38895	38923	38973	38995	39033	39051	39499
38896	38924	38975	38996	39034	39054	39527
38897	38925	38976	38997	39035	39055	
38898	38943	38978	38999	39036	39056	


BACKGROUND: Metal Flex Hosing (supplier of flexible metal housings) has recalled 195 total PS70104 .375" ID SS housings due to the ability of the coil to separate.

155 of these housings were received by Sun Path Products, Inc., 124 of which were installed in harness container assemblies, 27 pulled from inventory prior to use and 4 damaged/discarded.

(Note: this is not a failure mode. Separating of the coil does not impede normal operation or function of the system).

SERVICE BULLETIN: MANDATORY INSPECTION (COMPLIANCE WITH METAL FLEX HOSING MATERIAL RECALL)

Who can inspect: Anyone can inspect this area. See photos below.

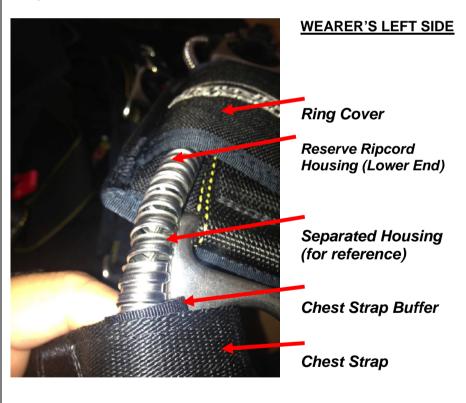


What to inspect: All JA101---XX harness container systems listed in table above. Inspect Reserve Ripcord housing.

PROCEDURE: If the serial number is listed in the above table, inspect the available exposed reserve ripcord housing. Locate the lower end of the housing, which is clamped to the Main Lift Web, just above the reserve ripcord pocket. Inspect the exposed length of housing from the

Concerned Publication	Sun Path Service Bulletin # SPSB009 dated 20 May 2013.
Compliance	INSPECTION BEFORE NEXT JUMP (BY ANYONE) AND MANDITORY HOUSING REPLACEMENT AT NEXT REPACK CYCLE BY FAA SENIOR OR MASTER PARACHUTE RIGGER OR FOREIGN EQUAL.MANDATORY INSPECTION AND REPLACEMENT OF RECALLED HOUSINGS.
	COMPLIANCE DATE: INSPECTION BEFORE NEXT JUMP (BY ANYONE) AND MANDITORY HOUSING REPLACEMENT AT NEXT REPACK CYCLE BY FAA SENIOR OR MASTER PARACHUTE RIGGER OR FOREIGN EQUAL.
	 B. HOUSINGS ARE SEPERATED/UNRAVELLED: 1. GO TO http://www.sunpath.com/support/HousingReplacement.pdf FOR FURTHER INSTRUCTIONS ON REPLACEMENT OF THE SUBJECT HOUSINGS. 2. AT TIME OF REPLACEMENT, FILL OUT WEB FORM AND SUBMIT at http://www.sunpath.com/MetalFlexRecall.html; NOTE ON PACKING DATA CARD AND RIGGER LOG BOOK, SPSB009 COMPLETEDREPLACED. 3.NO FURTHER ACTION REQUIRED.
	 <i>Resolution:</i> A: Housing is intact and will be monitored and replaced at the inspection/repack cycle. 1. NOTE ON PACKING DATA CARD, SPSB009 COMPLETED 2. AT TIME OF REPLACEMENT, FILL OUT WEB FORM AND SUBMIT at http://www.sunpath.com/MetalFlexRecall.html and add "<i>-Replaced</i> " after SPSB009 COMPLETED from step 1 above. 3. NO FURTHER ACTION REQUIRED
	sure to inspect the section that is routed through the chest strap. <i>Inspection Results:</i> A. HOUSING FOUND TO BE INTACT (GOOD): The rig may continue to be jumped with periodic monitoring until the next repack cycle or earlier elective replacement. However this housing must be replaced at the next repack cycle. See <u>http://www.sunpath.com/support/HousingReplacement.pdf</u> for instructions for your rigger to complete the replacement of the housing. B. HOUSING FOUND TO BE SEPERATED/UNRAVELLED (BAD): The housing must be replaced before the next jump by a certificated senior or master parachute rigger (or foreign equal) or the manufacturer. See <u>http://www.sunpath.com/support/HousingReplacement.pdf</u> for instructions for your rigger to complete the replacement of the housing or instructions for your system back to the manufacturer.

DAVID L. SINGER
Sun Path Products, Inc.
Director of Engineering
404 West Edinborough Ave., Raeford, NC 28376, USA
Telephone: 9108759002
FAX: 9108759272

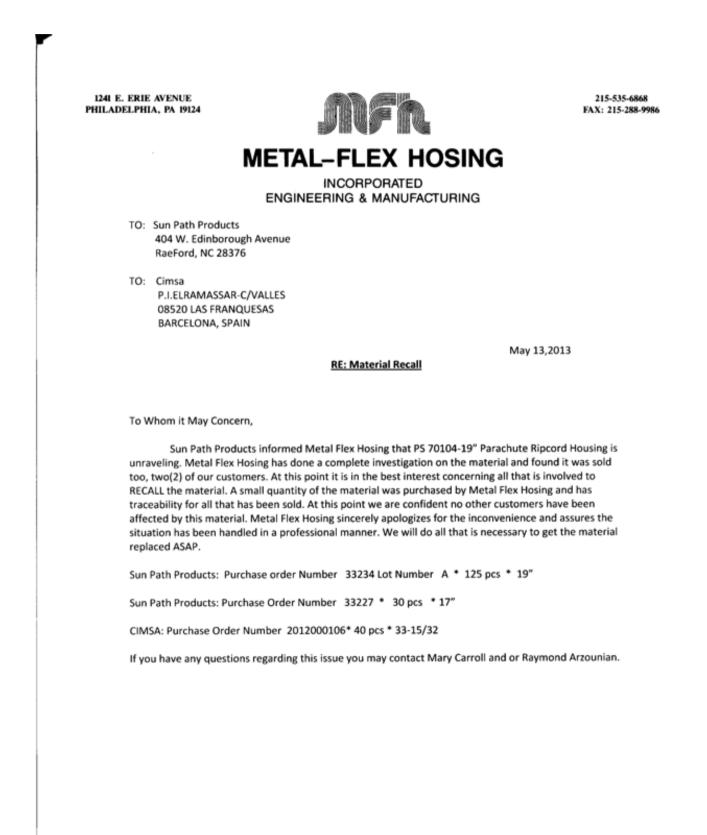

Thanks to Ms Kim Hardwick, Technical Officer, Australian Parachute Federation, for bringing this Service Bulletin to the attention of the IPC T&S Committee.

Technical and Safety Information Notices issued by the Technical & Safety Committee of the International Parachuting Commission (FAI) are issued as information and help to parachuting nations and their affiliated members. The Information Notices are of an objective informative nature and there is no direct or implied criticism of any manufacturer or product intended. The Information Notices do not claim to be complete.

The Information Notices may result from:-

- 1 An incident or experience in the field being reported.
- 2 A directive or notice issued by an aviation or government authority concerning parachuting operations or parachuting equipment.
- 3 The issue of a notice by a manufacturer or by a National Parachuting Organisation. In the case of equipment being the subject of the bulletin the reader is advised to check with the manufacturer regarding the current status or position of that equipment.

Technical & Safety Committee of IPC, IPC and FAI accept no liability for the use or misuse of any information contained in this Information Notice. The reader assumes all liability.

The Technical & Safety Committee, International Parachuting Commission, can be contacted on e-mail - <u>Imcnulty@skydiveireland.ie</u>

Liam McNulty, Technical & Safety Committee, International Parachuting Commission. 27 May 2013